



WLLA0010A

15 - 600 MHz LOW NOISE WIDE BAND LIMITER AMPLIFIER

REV A
March 2018

Key Features



- 50 Ohm Impedance
- 15 – 600 MHz
- 0.60 dB Noise Figure
- 35.0 dBm Output IP₃
- 42.0 dB Gain
- +/-0.5 dB Gain Flatness
- 18.0 dBm P_{1dB}
- 1.25:1 VSWR
- Single DC Power Supply
- >34 Years MTBF
- Unconditional Stable
- RoHS Compliant

Product Description

WLLA0010A is integrated with WanTcom proprietary low noise amplifier technology, high frequency micro electronic assembly techniques, and high reliability design to realize optimum low noise figure, wide bandwidth, high linearity, and unconditional stable performances together. With single DC voltage operation, the amplifier has optimal input and output matching in the specified frequency range at 50-Ohm impedance system. The amplifier has standard SMA connectorized WP-5 Gold plated housing.

The amplifier is designed to meet the rugged standard of MIL-STD-202g.

CAUTION:



ELECTROSTATIC DISCHARGE SENSITIVE

Applications

- Mobile Infrastructures
- GPS
- Astronomy
- Defense
- Security System
- Measurement
- Fixed Wireless



Specifications

Summary of the electrical specifications WLLA0010A at room temperature


Index	Testing Item	Symbol	Test Constraints	Min	Nom	Max	Unit
1	Gain	S ₂₁	15 – 600 MHz		42		dB
2	Gain Variation	ΔG	15 – 600 MHz		+/- 0.5	+/-0.1.0	dB
3	Input VSWR	SWR ₁	15 – 600 MHz		1.25:1	1.5:1	Ratio
4	Output VSWR	SWR ₂	15 – 600 MHz		1.25:1	1.5:1	Ratio
5	Reverse Isolation	S ₁₂	15 – 600 MHz		45		dB
6	Noise Figure	NF	15 – 100 MHz	0.60		1.20	dB
			100 – 600 MHz		0.60	0.80	
7	Output 1dB Gain Compression Point	P _{1dB}	15 – 600 MHz	16	18		dBm
8	Output Third Order Interception Point	IP ₃	Two-tone, P _{out} =+0 dBm each, 1 MHz sep.	30	35		dBm
9	Current Consumption	I _{dd}	V _{dd}		90		mA
10	Power Supply Voltage	V _{dd}	WLLA0010A	+4.7	+5.0	+5.3	V
			WLLA0010B	+8.0		+16.0	
11	Thermal Resistance, Junction to Case	R _{th,c}	Last stage transistor V _{ds} = 3.0V, I _{ds} = 65 mA,			220	°C/W
12	Operating Temperature	T _o	--	-40		+85	°C
13	Maximum Input CW RF Power	P _{IN, MAX}	DC – 6 GHz			30	dBm

Absolute Maximum Ratings

Parameters	Units	Ratings
DC Power Supply Voltage	V	-0.5, +6V /+24V
Drain Current	mA	120
Total Power Dissipation	mW	1500
Input CW RF Power	dBm	30
Junction Temperature	°C	170
Storage Temperature	°C	-55 ~ 125
Operating Temperature	°C	-40 ~ 85
Thermal Resistance	°C/W	220

Operation of this device above any one of these parameters may cause permanent damage.

Functional Block Diagram

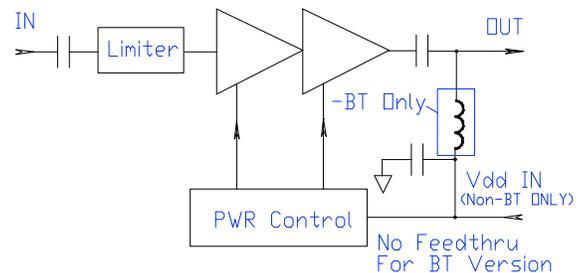

Ordering Information

DC Voltage	Without Output Bias-T	With Output Bias-T
V _{dd} = +5.0 V	WLLA0010A	WLLA0010ABT
V _{dd} = +8.0 ~ +16.0V	WLLA0010B	WLLA0010BBT

Specifications and information are subject to change without notice.



WLLA0010A

15 - 600 MHz LOW NOISE WIDE BAND LIMITER AMPLIFIER

REV A
March 2018

Typical Data


Preliminary




Outline, WP-5 Housing

UNITS: INCH
[mm]
BODY: Brass
Finish: Gold Plating
RF Connector: SMA F Gold
V_{dd} PWR: Feed through

WLLA0010A/B

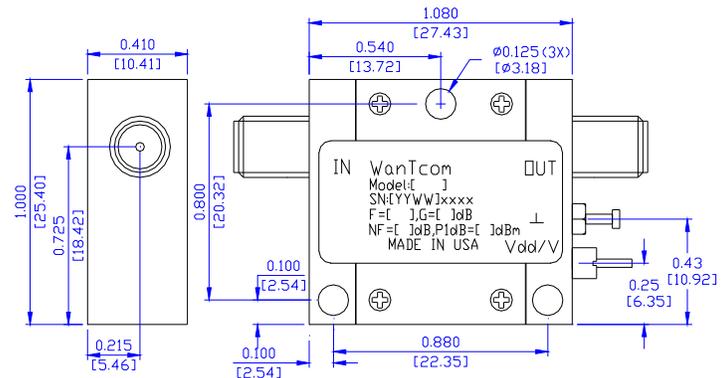

WLLA0010A/BBT

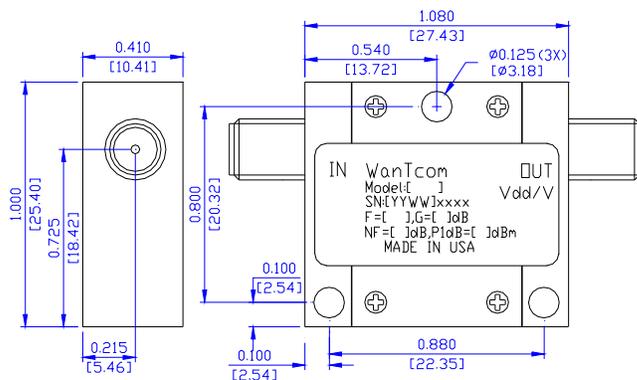

Application Notes:

A. SMA Torque Wrench Selection

Always use a torque wrench with 5 ~ 6 inch-lb coupling torque setting for mating the SMA cables to the amplifier. Never use torque more than 8 inch-lb wrench for tightening the mating cable to the connectors. Otherwise, the permanent damage will occur to the SMA connectors of the amplifier. 8710-1582 (5 inch-lb) is one of the ideal torque wrench choice from Agilent Technology.

B. DC Power Line Connection

Strip the insulation layer at the end of DC power supply wire. The stripped length should be around 0.100" to 0.200". The 24 ~ 26 American Wire Gauge wire is suitable. Wound the stripped wire about 3/4 to 1 turn on the DC feed thru center pin. Solder the wounded wire and the center pin together. Clean the soldering joint by a Q-tip with alcohol to remove the flux and residue.

Do not use large soldering iron tip with more than 750 degree Fahrenheit to solder the wire and feed thru pin. Damage may occur to the feed thru. 0.010" size tip with 750 degree Fahrenheit temperature setting is suitable for the soldering works.

Repeat the process to solder the DC return wire on the ground turret. Higher temperature and larger tip can be used for this ground soldering.

C. Mounting the Amplifier

Use three pieces of #4-40 with longer than 9/16" screws for mounting the amplifier on a metal-based chase. Flat and spring washers are needed to prevent the screw loosening. Always use the appropriate torque setting of the power screwdriver to mount screws.

Specifications and information are subject to change without notice.